

Navigation Database Addendum

AIRAC 1811 – Issue 8

AIRAC AMDT 1/18 effective 11th October 2018

SAEF SA Argentina

Waypoint RIOKA; AWY UZ 103

Airway UZ 103 and waypoint RIOKA are missing:

UZ103:

DALAB S32-20.0 W058-40.3 (S32-20-00.00 W058-40-15.00)

ATIPI S30-53.6 W058-22.5 (S30-53-36.00 W058-22-32.00)

RIOKA S30-35.8 W058-18.6 (S30-35-46.00 W058-18-37.00)

AKSAS S29-49.1 W058-09.7 (S29-49-03.00 W058-09-39.00)

SOTSA S29-25.1 W058-04.7 (S29-25-08.00 W058-04-40.00)

MASDO S28-17.9 W057-47.1 (S28-17-51.00 W057-47-06.00)

REPAM S27-25.8 W057-33.5 (S27-25-45.00 W057-33-30.00)

Navdata will be updated effective AIRAC cycle 1812.

Please disseminate this information to all affected crews

Lufthansa Systems
FMS Customer Support
12th October 2018

All valid FSAs/NDAs are available on <http://fms-info.lhsystems.com>
For any inquiries, please contact fms.support@lhsystems.com